



# MICROCHIP PIC18F2423/2523/4423/4523

## PIC18F2423/2523/4423/4523 Rev. B2 Silicon Errata

The PIC18F2423/2523/4423/4523 Rev. B2 parts you have received conform functionally to the Device Data Sheet (DS39755B), except for the anomalies described below. Any Data Sheet Clarification issues related to the PIC18F2423/2523/4423/4523 will be reported in a separate Data Sheet errata. Please check the Microchip web site for any existing issues.

The following silicon errata apply only to PIC18F2423/2523/4423/4523 devices with these Device/Revision IDs:

Part Number	Device ID	Revision ID
PIC18F2423	0001 0001 010	10101
PIC18F2523	0001 0001 000	10101
PIC18F4423	0001 0000 110	10101
PIC18F4523	0001 0000 100	10101

The Device IDs (DEVID1 and DEVID2) are located at addresses 3FFFFEh:3FFFFh in the device's configuration space. They are shown in hexadecimal in the format "DEVID2 DEVID1".

### 1. Module: MSSP

In SPI Slave mode with slave select enabled (SSPM<3:0> = 0100), the minimum time between the falling edge of the  $\overline{SS}$  pin and first SCK edge is greater than specified in parameter 70 in Table 26-14 and Table 26-16. The updated specification is shown in bold in Table 1.

The minimum time between  $\overline{SS}$  pin low and an SSPBUF write is also 3 T<sub>cy</sub>. If the falling edge of the  $\overline{SS}$  pin occurs greater than 3 T<sub>cy</sub> before the first SCK edge, or loading SSPBUF, the peripheral will function correctly. Also, if SSPBUF is written prior to the  $\overline{SS}$  pin going low, the peripheral will function correctly.

#### Work around

None.

#### Date Codes that pertain to this issue:

All engineering and production devices.

TABLE 1: EXAMPLE SPI MODE REQUIREMENTS (SLAVE MODE TIMING)

Param No.	Symbol	Characteristic	Min	Max	Units	Conditions
70	T <sub>ssL2sch</sub> , T <sub>ssL2scl</sub>	$\overline{SS}$ ↓ to SCK ↓ or SCK ↑ Input	<b>3 T<sub>cy</sub></b>	—	ns	

# PIC18F2423/2523/4423/4523

---

## 2. Module: MSSP

With MSSP in SPI Master mode,  $F_{osc}/64$  or Timer2/2 clock rate, and  $CKE = 0$ , a write collision may occur if SSPBUF is loaded immediately after the transfer is complete. A delay may be required after the MSSP Interrupt Flag bit, SSPIF, is set or the Buffer Full bit, BF, is set and before writing SSPBUF. If the delay is insufficiently short, a write collision may occur, as indicated by the WCOL bit being set.

### Work around

Add a software delay of one SCK period after detecting the completed transfer and prior to updating the SSPBUF contents. Verify the WCOL bit is clear after writing SSPBUF. If the WCOL is set, clear the bit in software and rewrite the SSPBUF register.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 3. Module: Timer1 and Timer3

For Timer1 or Timer3, if the TMRxH and TMRxL registers are written to in consecutive instruction cycles, the timer may not be updated with the correct value when configured for externally clocked 8-Bit Asynchronous mode ( $T1CON<7:0>$  or  $T3CON<7:0> = 0xxx\ x111$ ).

### Work around

Insert a delay of one or more instruction cycles between writes to TMRxH and TMRxL. This delay can be a `NOB`, or any instruction that does not access the Timer registers (Example 1).

### **EXAMPLE 1:**

```
CLRF    TMR1H
MOVLW  T1Offset ; 1 Tcy delay
MOVWF  TMR1L
```

### Date Codes that pertain to this issue:

All engineering and production devices.

## 4. Module: ECCP (PWM Mode)

**Note:** The ECCP module is implemented only in 40/44-pin devices.

When configured for half-bridge operation with dead band ( $CCPxCON<7:6> = 10$ ), the PWM output may be corrupted for certain values of the PWM duty cycle. This occurs when these additional criteria are also met:

- a non-zero, dead-band delay is specified ( $PDC6:PDC0 > 0$ ); and
- the duty cycle has a value of 0 through 3, or  $4n + 3$  ( $n \geq 1$ ).

### Work around

None.

### Date Codes that pertain to this issue:

All engineering and production devices.

# PIC18F2423/2523/4423/4523

## 5. Module: Enhanced Universal Synchronous Receiver Transmitter (EUSART)

One bit has been added to the BAUDCON register and one bit has been renamed. The added bit is RXDTP and is in the location, BAUDCON<5>. The renamed bit is the TXCKP bit (BAUDCON<4>), which had been named SCKP.

The TXCKP (BAUDCON<4>) and RXDTP (BAUDCON<5>) bits enable the TX and RX signals to be inverted (polarity reversed).

Register 18-3, on page 208, will be changed as shown.

### Work around

None required.

### Date Codes that pertain to this issue:

All engineering and production devices.

## REGISTER 18-3: BAUDCON: BAUD RATE CONTROL REGISTER

R/W-0	R-1	R/W-0	R/W-0	R/W-0	U-0	R/W-0	R/W-0
ABDOVF	RCIDL	RXDTP	TXCKP	BRG16	—	WUE	ABDEN
bit 7							bit 0

### Legend:

R = Readable bit	W = Writable bit	U = Unimplemented bit, read as '0'
-n = Value at POR	'1' = Bit is set	'0' = Bit is cleared
		x = Bit is unknown


- bit 7 **ABDOVF**: Auto-Baud Acquisition Rollover Status bit  
 1 = A BRG rollover has occurred during Auto-Baud Rate Detect mode (must be cleared in software)  
 0 = No BRG rollover has occurred
- bit 6 **RCIDL**: Receive Operation Idle Status bit  
 1 = Receive operation is Idle  
 0 = Receive operation is Active
- bit 5 **RXDTP**: Receive Data Polarity Select bit  
Asynchronous mode:  
 1 = Receive data (RX) is inverted. Idle state is a low level.  
 0 = No inversion of receive data (RX). Idle state is a high level.  
Synchronous mode:  
 1 = Data (DT) is inverted. Idle state is a low level.  
 0 = No inversion of data (DT). Idle state is a high level.
- bit 4 **TXCKP**: Transmit/Clock Polarity Select bit  
Asynchronous mode:  
 1 = Transmit data (TX) is inverted. Idle state is a low level.  
 0 = No inversion of transmit data (TX). Idle state is a high level.  
Synchronous mode:  
 1 = Idle state for clock (CK) is a high level  
 0 = Idle state for clock (CK) is a low level
- bit 3 **BRG16**: 16-bit Baud Rate Register Enable bit  
 1 = 16-bit Baud Rate Generator – SPBRGH and SPBRG  
 0 = 8-bit Baud Rate Generator – SPBRG only (Compatible mode); SPBRGH value ignored
- bit 2 **Unimplemented**: Read as '0'
- bit 1 **WUE**: Wake-up Enable bit  
Asynchronous mode:  
 1 = EUSART will continue to sample the RX pin with the interrupt generated on the falling edge; bit cleared in hardware on following rising edge  
 0 = RX pin is not monitored or rising edge detected  
Synchronous mode:  
 Unused in this mode.
- bit 0 **ABDEN**: Auto-Baud Detect Enable bit  
Asynchronous mode:  
 1 = Enable baud rate measurement on the next character. Requires reception of a Sync field (55h); cleared in hardware upon completion.  
 0 = Baud rate measurement disabled or completed  
Synchronous mode:  
 Unused in this mode.

# PIC18F2423/2523/4423/4523

## 6. Module: MSSP (SPI Mode)

When the SPI is using Timer2/2 as the clock source, a shorter than expected SCK pulse may occur on the first bit of the transmitted/received data (Figure 1).

**FIGURE 1: SCK PULSE VARIATION USING TIMER2/2**

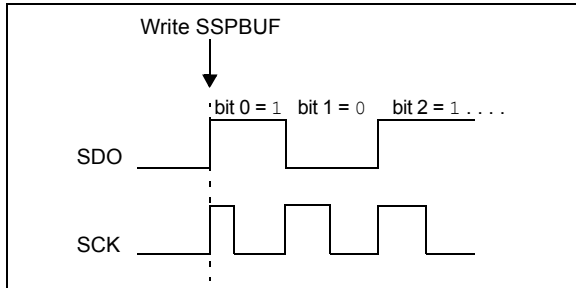

### Work around

To avoid producing the short pulse, turn off Timer2 and clear the TMR2 register, load the SSPBUF with the data to transmit and then turn Timer2 back on. Refer to Example 2 for sample code.

## EXAMPLE 2: AVOIDING THE INITIAL SHORT SCK PULSE

```
LOOP BTFSS SSPSTAT, BF      ;Data received?
                                ;(Xmit complete?)
    BRA    LOOP              ;No
    MOVF  SSPBUF, W          ;W = SSPBUF
    MOVWF RXDATA             ;Save in user RAM
    MOVF  TXDATA, W         ;W = TXDATA
    BCF   T2CON, TMR2ON     ;Timer2 off
    CLRF  TMR2              ;Clear Timer2
    MOVWF SSPBUF            ;Xmit New data
    BSF   T2CON, TMR2ON     ;Timer2 on
```

### Date Codes that pertain to this issue:

All engineering and production devices.

## 7. Module: 12-Bit Analog-to-Digital Converter

When the AD clock source is selected as 2 TOSC or RC (when ADCS2:ADCS0 = 000 or x11), the EIL (Integral Linearity Error) and EDL (Differential Linearity Error) may exceed the data sheet specification at codes 2047, 2048 and 2049.

### Work around

Select the AD clock source as 4 TOSC, 8 TOSC, 16 TOSC, 32 TOSC or 64 TOSC and avoid selecting 2 TOSC or RC.

### Date Codes that pertain to this issue:

All engineering and production devices.

## REVISION HISTORY

### Rev A Document (08/2006)

First revision of this document. Silicon issues 1-2 (MSSP).

### Rev B Document (10/2006)

Added silicon issue 3 (Timer1 and Timer3).

### Rev C Document (11/2006)

Updated silicon issue 3 (Timer1 and Timer3) and added silicon issue 4 (ECCP – PWM Mode).

### Rev D Document (5/2007)

Added silicon issue 5 (Enhanced Universal Synchronous Receiver Transmitter – EUSART) and 6 (MSSP – SPI Mode).

### Rev E Document (6/2007)

Added silicon issue 7 (12-Bit Analog-to-Digital Converter).

# PIC18F2423/2523/4423/4523

---

NOTES:

---

**Note the following details of the code protection feature on Microchip devices:**

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

---

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

**Trademarks**

The Microchip name and logo, the Microchip logo, Accuron, dsPIC, KEELOQ, KEELOQ logo, microID, MPLAB, PIC, PICmicro, PICSTART, PRO MATE, rPIC and SmartShunt are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.


AmpLab, FilterLab, Linear Active Thermistor, Migratable Memory, MXDEV, MXLAB, SEEVAL, SmartSensor and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, ECAN, ECONOMONITOR, FanSense, FlexROM, fuzzylAB, In-Circuit Serial Programming, ICSP, ICEPIC, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, PICkit, PICDEM, PICDEM.net, PICLAB, PICtail, PowerCal, PowerInfo, PowerMate, PowerTool, REAL ICE, rLAB, Select Mode, Smart Serial, SmartTel, Total Endurance, UNI/O, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2007, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

**QUALITY MANAGEMENT SYSTEM  
CERTIFIED BY DNV  
== ISO/TS 16949:2002 ==**

*Microchip received ISO/TS-16949:2002 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.*



---

---

## WORLDWIDE SALES AND SERVICE

---

---

### AMERICAS

**Corporate Office**  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://support.microchip.com>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

**Atlanta**  
Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

**Boston**  
Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

**Chicago**  
Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

**Dallas**  
Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

**Detroit**  
Farmington Hills, MI  
Tel: 248-538-2250  
Fax: 248-538-2260

**Kokomo**  
Kokomo, IN  
Tel: 765-864-8360  
Fax: 765-864-8387

**Los Angeles**  
Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608

**Santa Clara**  
Santa Clara, CA  
Tel: 408-961-6444  
Fax: 408-961-6445

**Toronto**  
Mississauga, Ontario,  
Canada  
Tel: 905-673-0699  
Fax: 905-673-6509

### ASIA/PACIFIC

**Asia Pacific Office**  
Suites 3707-14, 37th Floor  
Tower 6, The Gateway  
Harbour City, Kowloon  
Hong Kong  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**Australia - Sydney**  
Tel: 61-2-9868-6733  
Fax: 61-2-9868-6755

**China - Beijing**  
Tel: 86-10-8528-2100  
Fax: 86-10-8528-2104

**China - Chengdu**  
Tel: 86-28-8665-5511  
Fax: 86-28-8665-7889

**China - Fuzhou**  
Tel: 86-591-8750-3506  
Fax: 86-591-8750-3521

**China - Hong Kong SAR**  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**China - Qingdao**  
Tel: 86-532-8502-7355  
Fax: 86-532-8502-7205

**China - Shanghai**  
Tel: 86-21-5407-5533  
Fax: 86-21-5407-5066

**China - Shenyang**  
Tel: 86-24-2334-2829  
Fax: 86-24-2334-2393

**China - Shenzhen**  
Tel: 86-755-8203-2660  
Fax: 86-755-8203-1760

**China - Shunde**  
Tel: 86-757-2839-5507  
Fax: 86-757-2839-5571

**China - Wuhan**  
Tel: 86-27-5980-5300  
Fax: 86-27-5980-5118

**China - Xian**  
Tel: 86-29-8833-7250  
Fax: 86-29-8833-7256

### ASIA/PACIFIC

**India - Bangalore**  
Tel: 91-80-4182-8400  
Fax: 91-80-4182-8422

**India - New Delhi**  
Tel: 91-11-4160-8631  
Fax: 91-11-4160-8632

**India - Pune**  
Tel: 91-20-2566-1512  
Fax: 91-20-2566-1513

**Japan - Yokohama**  
Tel: 81-45-471- 6166  
Fax: 81-45-471-6122

**Korea - Gumi**  
Tel: 82-54-473-4301  
Fax: 82-54-473-4302

**Korea - Seoul**  
Tel: 82-2-554-7200  
Fax: 82-2-558-5932 or  
82-2-558-5934

**Malaysia - Penang**  
Tel: 60-4-646-8870  
Fax: 60-4-646-5086

**Philippines - Manila**  
Tel: 63-2-634-9065  
Fax: 63-2-634-9069

**Singapore**  
Tel: 65-6334-8870  
Fax: 65-6334-8850

**Taiwan - Hsin Chu**  
Tel: 886-3-572-9526  
Fax: 886-3-572-6459

**Taiwan - Kaohsiung**  
Tel: 886-7-536-4818  
Fax: 886-7-536-4803

**Taiwan - Taipei**  
Tel: 886-2-2500-6610  
Fax: 886-2-2508-0102

**Thailand - Bangkok**  
Tel: 66-2-694-1351  
Fax: 66-2-694-1350

### EUROPE

**Austria - Wels**  
Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393

**Denmark - Copenhagen**  
Tel: 45-4450-2828  
Fax: 45-4485-2829

**France - Paris**  
Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79

**Germany - Munich**  
Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44

**Italy - Milan**  
Tel: 39-0331-742611  
Fax: 39-0331-466781

**Netherlands - Drunen**  
Tel: 31-416-690399  
Fax: 31-416-690340

**Spain - Madrid**  
Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91

**UK - Wokingham**  
Tel: 44-118-921-5869  
Fax: 44-118-921-5820

12/08/06